

* CAMPBELL SCIENTIFIC: REPAIR CHARGE REPORT *

Report Date : 14-MAY-2001
Page : 1 OF 1

Currency USD

Charge Number : 10356
Customer : HEHN TED 20195
Ship To : 54136
UNIVERSITY OF CALIFORNIA, ECOSYSTEMS SCIENCE DIV
205 HILGARD HALL
BERKELEY, CA 94720-3110 US

Service Request # : 10230
Charge Date : 06-APR-2001
Phone : 510 642-9368
PO Number :
Application Eng MAUGHAN, CURTIS

 
Product / RMA# : HMP45C, RMA 3469
Problem Desc. : CALIBRATION WITH NIST DOCUMENTATION.
Resolution : REMOVED 18 INCHES OF CABLE THAT CUSTOMER HAD ADDED. POWER WAS ALWAYS SWITCH ON THE HMP45C, REPLACED TRANSISTOR Q1 (2N2222). THERE IS WATER DAMAGE AROUND THE "O" RING SEAL. MFG SHOULD REPAIR WATER DAMAGE. RECEIVED REPLACEMENT SENSOR FROM MFG S/N W0510026. SENSOR HAS A NIST DOCUMENTATION. RECABLED NEW HMP45C TO 10FT. BENCH TESTED ASSEMBLY.

S/N : U3030042

Seq	Item or labor	UOM	Quantity	Price	Extended Price	Charge
1	SEMSM TRAN NPN MMBT2222A SOT-23	EA	1	.28	0.28	0.00
2	ATECH LABOR AT NO CHARGE, UNDER WARRANTY VINCE MARTIN	MIN	96	0	0.00	0.00
3	TECH LABOR AT NO CHARGE, UNDER WARRANTY TROY STERR	MIN	20	0	0.00	0.00
Total					0.28	0.00

Totals

Material: 0.00
Labor: 0.00



Ted Hehn
MAY 17 2001

Recd 21 May 01 Heh